




INSTALLATION INSTRUCTIONS

IMPORTANT: Turn off power before installing or removing connector. Product to be used in accordance with local and national codes.


- 1. Insert conductor into port, fully seating conductor into port. One conductor per port only.
- 2. Using hand tool, press cap fully into housing. The cap will be flush or slightly below the edge of the housing.
- 3. Wipe excess sealant in and around conductors and ports. Do not reuse.
- To be sold only with installation instructions.

THREE WIRE CONNECTION



TWO WIRE CONNECTION

NOTE: When installing solid and stranded conductor, place stranded in center port.

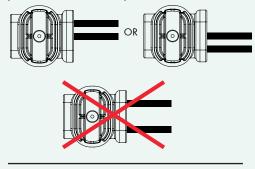

FEATURES AND BENEFITS

- Insulation displacement connector.
- Don't have to strip wires.

U.S. Pat. 9,496,626 and additional Patents Pending apply. All other trademarks, U.S. and Foreign Patents apply. All Rights Reserved.

NS Connector (No Strip)


SKU#	Selling Unit
236632	Bag of 10

PRODUCT SPECIFICATIONS AND MEASUREMENTS

Max. Voltage: 600V max. building wire (1000V max. signs or luminaries) Connector Size: .99" x .95" Wire Type: Copper/Copper (Solid/Stranded) Wire Range: Min #22/Max #14 Temperature Rating: 105°C (221°F) Silicone Sealant Temperature: -45°F to 400°F Tube Construction: Polycarbonate UV and Impact Resistant

Manufacturer approved for low voltage (30V) wet, damp and direct bury applications

Measurements (Inches):

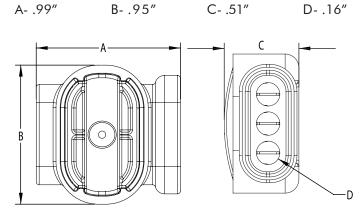

DO NOT REUSE. **MADE IN USA** 50100-116 REV A 12/17